

Model 3743G11200G

Accelerometer, VC, 200g, triaxial, differential, screw mount, integral M8 connector

Installation and Operating Manual

For assistance with the operation of this product, contact the PCB Piezotronics, Inc.

Toll-free: 716-684-0001 24-hour SensorLine: 716-684-0001 Fax: 716-684-0987 E-mail: info@pcb.com Web: www.pcb.com







Repair and Maintenance

PCB guarantees Total Customer Satisfaction through its "Lifetime Warranty Plus" on all Platinum Stock Products sold by PCB and through its limited warranties on all other PCB Stock, Standard and Special products. Due to the sophisticated nature of our sensors and associated instrumentation, field servicing and repair is not recommended and, if attempted, will void the factory warranty.

Beyond routine calibration and battery replacements where applicable, our products require no user maintenance. Clean electrical connectors, housings, and mounting surfaces with solutions and techniques that will not harm the material of construction. Observe caution when using liquids near devices that are not hermetically sealed. Such devices should only be wiped with a dampened cloth—never saturated or submerged.

In the event that equipment becomes damaged or ceases to operate, our Application Engineers are here to support your troubleshooting efforts 24 hours a day, 7 days a week. Call or email with model and serial number as well as a brief description of the problem.

Calibration

Routine calibration of sensors and associated instrumentation is necessary to maintain measurement accuracy. We recommend calibrating on an annual basis, after exposure to any extreme environmental influence, or prior to any critical test.

PCB Piezotronics is an ISO-9001 certified company whose calibration services are accredited by A2LA to ISO/IEC 17025, with full traceability to SI through N.I.S.T. In addition to our standard calibration services, we also offer specialized tests, including: sensitivity at elevated or cryogenic temperatures, phase response, extended high or low frequency response, extended range, leak testing, hydrostatic pressure testing, and others. For more information, contact your local PCB Piezotronics distributor, sales representative, or factory customer service representative.

Returning Equipment

If factory repair is required, our representatives will provide you with a Return Material Authorization (RMA) number, which we use to reference any information you have already provided and expedite the repair process. This number should be clearly marked on the outside of all returned package(s) and on any packing list(s) accompanying the shipment.

Contact Information

PCB Piezotronics, Inc. 3425 Walden Ave. Depew, NY14043 USA Toll-free: (800) 828-8840 24-hour SensorLine: (716) 684-0001 General inquiries: <u>info@pcb.com</u> Repair inquiries: <u>rma@pcb.com</u>

For a complete list of distributors, global offices and sales representatives, visit our website, <u>www.pcb.com</u>.

Safety Considerations

This product is intended for use by qualified personnel who recognize shock hazards and are familiar with the precautions required to avoid injury. While our equipment is designed with user safety in mind, the protection provided by the equipment may be impaired if equipment is used in a manner not specified by this manual.

Discontinue use and contact our 24-Hour Sensorline if:

- Assistance is needed to safely operate equipment
- Damage is visible or suspected
- Equipment fails or malfunctions

For complete equipment ratings, refer to the enclosed specification sheet for your product.

Definition of Terms and Symbols

The following symbols may be used in this manual:



DANGER

Indicates an immediate hazardous situation, which, if not avoided, may result in death or serious injury.



CAUTION

Refers to hazards that could damage the instrument.



NOTE

Indicates tips, recommendations and important information. The notes simplify processes and contain additional information on particular operating steps.

The following symbols may be found on the equipment described in this manual:



This symbol on the unit indicates that high voltage may be present. Use standard safety precautions to avoid personal contact with this voltage.



This symbol on the unit indicates that the user should refer to the operating instructions located in the manual.



This symbol indicates safety, earth ground.



PCB工业监视和测量设备 - 中国RoHS2公布表 PCB Industrial Monitoring and Measuring Equipment - China RoHS 2 Disclosure Table

	有害物 质								
部件名称	铅 (Pb)	汞 (Hg)	镉 (Cd)	六价铬 (Cr(VI))	多溴 联苯 (PBB)	多溴二苯 醚 (PBDE)			
住房	0	0	0	0	0	0			
PCB板	Х	0	0	0	0	0			
电气连接 器	0	0	0	0	0	0			
压电晶 体	х	0	0	0	0	0			
环氧	0	0	0	0	0	0			
铁氟龙	0	0	0	0	0	0			
电子	0	0	0	0	0	0			
厚膜基板	0	0	Х	0	0	0			
电线	0	0	0	0	0	0			
电缆	Х	0	0	0	0	0			
塑料	0	0	0	0	0	0			
焊接	Х	0	0	0	0	0			
铜合金 /黄 铜	Х	0	0	0	0	0			
本表格依据 SJ/T 1	L 1364 的 规定	E编制。							
0: 表示 该有害物	勿质在该部件	所有均同	気材料中	的含量均在 GB/T 26	572 规定的限量要求以	下。			
X:表示该有害物质至少在该部件的某一均质材料中的含量超出 GB/T 26572 规定的限量要求。 铅是欧洲RoHS指令2011/65/ EU附件三和附件四目前由于允许的豁免。									

CHINA ROHS COMPLIANCE

Component Name	Hazardous Substances								
	Lead (Pb)	Mercury (Hg)	Cadmium (Cd)	Chromium VI Compounds (Cr(VI))	Polybrominated Biphenyls (PBB)	Polybrominated Diphenyl Ethers (PBDE)			
Housing	0	0	0	0	0	0			
PCB Board	Х	0	0	0	0	0			
Electrical Connectors	0	0	0	0	0	0			
Piezoelectric Crystals	Х	0	0	0	0	0			
Ероху	0	0	0	0	0	0			
Teflon	0	0	0	0	0	0			
Electronics	0	0	0	0	0	0			
Thick Film Substrate	0	0	Х	0	0	0			
Wires	0	0	0	0	0	0			
Cables	Х	0	0	0	0	0			
Plastic	0	0	0	0	0	0			
Solder	Х	0	0	0	0	0			
Copper Alloy/Brass	Х	0	0	0	0	0			

This table is prepared in accordance with the provisions of SJ/T 11364.

O: Indicates that said hazardous substance contained in all of the homogeneous materials for this part is below the limit requirement of GB/T 26572.

X: Indicates that said hazardous substance contained in at least one of the homogeneous materials for this part is above the limit requirement of GB/T 26572.

Lead is present due to allowed exemption in Annex III or Annex IV of the European RoHS Directive 2011/65/EU.

General OPERATING GUIDE

for use with

High Sensitivity DC ACCELEROMETERS

PCB ASSUMES NO RESPONSIBILITY FOR DAMAGE CAUSED TO THIS PRODUCT AS A RESULT OF PROCEDURES THAT ARE INCONSISTENT WITH THIS OPERATING GUIDE

1.0 Introduction

This operating guide contains information that will familiarize the user with the basic operation and installation of the 3700 Series MEMS DC Accelerometers. However, it is not intended to cover all of the specific measurement challenges that one may encounter while using the device. Therefore, if you have detailed questions or are unsure of how to properly operate the sensor after reading this "Operating Guide", please contact a PCB Application Engineer using our 24-Hour SensorLineTM at 716-684-0001.

2.0 Common Applications and Features

The 3700 Series MEMS DC Accelerometers achieve true DC response for measuring uniform (or constant) acceleration and low-frequency vibration. For this reason, they are often used to:

- Perform ride quality assessments of elevators, automobiles, trains, and amusement park rides.
- Analyze the low frequency characteristics of buildings, bridges, and large aerospace objects.
- Acquire tilt and orientation data for feedback control and stabilization purposes.

Because of the critical nature of these and similar test applications, all 3700 series MEMS DC Accelerometers have been designed and manufactured with the following common characteristics:

- Built-in electronics provide conveniently standardized sensitivities and low-noise output signals unmatched by similar sensing technologies.
- Internal voltage regulator allows sensor to be powered from virtually any unregulated DC voltage source, such as a bench-top power supply or portable battery source.
- Gas damping extends the upper frequency range, attenuates unwanted high-frequency vibration, and provides stable performance over the entire operating temperature range.

3.0 Principle of Operation

The sensor element of the 3700 series features a proof mass, ring frame, and attachment system between the two. These features are micro machined from the same single-crystal silicon wafer. The movement of the proof mass is directly affected by acceleration applied in the axis of sensitivity.

The sensor element is connected as a bridge element in the circuit. The electrical characteristics of one portion of the bridge increase in value while the characteristics of the other portion decrease when exposed to acceleration. This approach minimizes common mode errors and improves non-linearity.

A selection of full scale measurement ranges is attained by modifying the stiffness of the suspension system of the proof mass. A high natural frequency is accomplished through the combination of a lightweight proof mass and suspension stiffness.

Ruggedness is enhanced through the use of mechanical stops to restrict the travel of the proof mass. Damping is used to mitigate high frequency inputs.

The sensor elements use squeeze-film gas damping. This is the result of the movement of the proof mass pressing on the gas in the gap between it and the outer sensor layer. Damping helps prevent the output of the accelerometer from becoming saturated, as would happen when the resonance of an accelerometer with no damping is excited by random vibration. The advantage of gas damping over liquid damping is that it is minimally affected by temperature changes.

The 3710 series accelerometers contain conditioning circuitry that provides a high sensitivity output. This ASIC (Application Specific Integrated Circuit) also provides compensation of zero bias and sensitivity errors over temperature.

Manual Number: 32650 Manual Revision: E ECR Number: 53457 The 3700 series DC Accelerometers are available in a uniaxial or triaxial package. The output signal is routed to follow-on signal conditioning via receptacle and associated cable assembly or integral cable. Since the High Sensitivity DC Accelerometers contain a built-in voltage regulator, they may be powered from virtually any power source without adversely affecting sensor performance, please refer to sensor specification for voltage range and current requirements. Consult PCB Application Engineering for signal conditioning options if needed. The output from the signal conditioner is typically routed to readout instrumentation such as oscilloscopes or various model data acquisition instruments.

5.0 Sensor Installation

When choosing an installation technique, be certain to carefully examine the different application characteristics that may affect sensor performance. Characteristics such as mounting location may limit the use of large mounting blocks or the amplitude range may necessitate the use of a stud mount rather than using adhesive. A summary of the recommended mounting methods is provided below.

<u>Stud Mount:</u> Recommended for permanent mount applications or in test situations that require a rugged or secure installation. The necessary information, including surface finish, mounting hole dimensions, and recommended mounting torque for installing the sensor is listed on the enclosed Sensor Installation Drawing. It is recommended that an experienced technician or machinist with good machining capabilities adequately prepare the surface.

<u>Adhesive Mount:</u> Recommended for temporary mounting of the sensor or when the test object surface cannot be properly prepared for stud mounting. Wax works well for temporary mount applications under conditions where the operating temperature will not melt the wax or the acceleration levels will not dislodge the sensor from the test object. If using cyanoacrylate-based adhesives for a quick mounting method or two-part epoxies for a more secure mount, PCB recommends mounting DC accelerometers via an adhesive mounting base. The base acts as a sacrificial part allowing safe removal of accelerometer after test is completed. If a base is not used, care must be taken as to not damage the sensor during removal.

NOTE: A chemical debonder should always be used

With so many adhesives in use (everything from super glues, dental cement, epoxies, etc), there is no universal de-bonding agent available. The de-bonder for the Loctite 454 adhesive that PCB offers is Acetone. If you are using anything other than Loctite 454, you will have to check with the individual manu-

facturers for their de-bonding recommendations. The de-bonding agent must be allowed to penetrate the surface in order to properly react with the adhesive, so it is advisable to wait a few minutes before removing the sensor.

After the de-bonding agent has softened the adhesive, use a gentle shearing (or twisting) motion to remove the base and/or sensor from the test structure.

Easy Mount Clip: Recommended when frequent installation and removal of Series 3700 series accelerometers is desired. Depending on the Easy-Mount Clip design, it can either be stud mounted or adhesively mounted to the test structure. (If adhesively mounting the clip, detach the sensor from the clip first, as excessive adhesive may creep through the mounting holes and adhere to the sensor. This will make separation and removal from the clip difficult.) Once the Easy-Mount Clip has been attached to the test structure, the sensor can be easily snapped into and out of the clip. Over time, the Easy-Mount Clip must be replaced as it will "wear-out" and eventually lose its ability to securely hold the sensor.

6.0 Powering

The 3710 Series contains built-in microelectronics that will operate from many PCB Sensor Signal Conditioners. These signal conditioners provide the necessary voltage and current required for all of the powering options available on the 3700 series. If a signal conditioner is needed, please consult with the factory for the proper conditioner that best fits the application.

The 3700 series may also be powered by other voltage sources such as DC voltage laboratory supplies, automotive or marine batteries, or low-voltage supplies designed for powering PC Board components. Ensure that the source provides power within the excitation voltage range and current listed on the specification sheet for that model. It is important to note that since the accelerometers contain a built-in voltage regulator, precise calibration of the power source is generally not required.

7.0 Operation

After the sensor has been installed and the cable connected for proper operation, there are a couple of measurement points to take note of:

- To take advantage of the DC response of the accelerometer, the readout device must be in a DC coupled state. Consult the appropriate manufacturer or product manual for your readout device for details.
- Because the 3700 series can measure static (constant) accelerations, the DC offset voltage will be affected by the positional alignment relative to the Earth's gravity. In other

Manual Number: 32650 Manual Revision: E ECR Number: 53457

2

words, when the sensor is mounted perpendicular with the Earth's surface, the offset will equal that as specified on the calibration certificate for "zero-g offset voltage." If the sensor is mounted parallel with the Earth's surface, the sensor will be experiencing 1 g of acceleration and the offset voltage will increase by the sensitivity of the accelerometer.

- If the sensor is extended, in the case of an integral cable sensor, or a cable length other than 10 ft is used, in the case of sensor with an integral connector, the offset voltage will change. To determine the accelerometer's offset, rotate the unit 90° so that the sensor is on its side with the sensing axis perpendicular to Earth's gravity and record the DC output. This value is the new "zero-g offset voltage."
- To ensure that ground loops are not induced, the shield should only be terminated at one end. Typically, the shield of the cable is tied to the sensor housing. If the sensor is mounted with an isolation pad (or other form of electrical isolation) from the test structure, then the shield should be tied to signal ground at the instrumentation end. Otherwise, leave the cable shield floating or not connected at the instrumentation end.

8.0 Sensor Verification

If the sensor has been handled in a rough manner or before using a sensor for a critical measurement application, it is a good idea to verify that the sensor's sensitivity is still within specification. An accurate static calibration of the 3700 series can be performed using the Earth's Gravitational Field as a reference. The sensor can simply be "flipped" (rotated 180°) in the Earth's Gravity to obtain the scaling factor (sensitivity) and DC offset. First, place the accelerometer in a +1g orientation so that the base is resting on the table and the model number is facing up. The sensing axis will be parallel with the Earth's gravity with the sensor experiencing +1g acceleration. Record the DC output by using a DVM. Then rotate the sensor 180° so that the sensor is inverted (the top of the sensor is resting on the table) and the sensor is experiencing -1g acceleration. Record the DC output. To calculate the sensitivity of the accelerometer, refer to equation 8.1.

Sensitivity =
$$\underline{(+1g)} - \underline{(-1g)}$$
 Eq 8.1

9.0 Sensor Calibration

Due to ISO 9001, ISO Guide 25, or other contractual requirements, it may become necessary to send the accelerometer back to PCB for recalibration. In this case, a complete back-to-back frequency response test will be performed and the "zero-g" offset voltage will be checked with NIST traceable equipment.

10.0 Maintenance and Repair

Because of the sophisticated nature of PCB instrumentation, field repair of the equipment is not recommended. Most PCB sensors are of modular construction and are factory repairable. A repair or replacement quotation is available at no charge. Before returning equipment for repair, it is recommended that the user confer with a factory application engineer (or inter-national representative) to first troubleshoot the problem.

11.0 Return Procedure

To expedite the repair process, contact a factory Application Engineer to obtain a Return Material Authorization (RMA) number prior to sending equipment to the factory. Please have information, such as model number, serial number and description of the problem, available.

Customers outside the U.S. should consult their local PCB distributor for information on returning equipment. For exceptions to this guideline, please contact the International Sales department to request shipping instructions and an RMA.

For further assistance, please call (716) 684-0001 or fax us at (716) 684-0987. You may also receive assistance via e-mail at info@pcb.com or visit our web site at www.pcb.com.

12.0 Customer Service / Warranty


The employees of PCB strive to provide superior, unmatched customer service. Should you at any time find yourself dissatisfied with any PCB product for any reason, consult a factory Application Engineer or local representative/distributor to discuss repair, refund, or exchange procedures.

When unexpected measurement problems arise, call our 24hour SensorLineTM at (716) 684-0001 to discuss your immediate dynamic instrumentation needs with a PCB Application Engineer.

> Manual Number: 32650 Manual Revision: E ECR Number: 53457

3

3743G11200G	TR	AXIAL DC RE	SPONS		OMETER			Revision: A ECN #: 55463
erformance	ENGLISH	SI				OPTIONAL VER	SIONS	
ensitivity(± 3 %)	13.5 mV/g	1.38 mV/(m/s ²)	[1]	Optional version	s have identical speci	fications and acces	sories as listed for the s	andard model e
leasurement Range	± 200 g pk	± 1,962 m/s ² pk	·		where noted b	elow. More than o	ne option may be used.	
equency Range(± 5 %)	0 to 1,500 Hz	0 to 1,500 Hz						
equency Range(± 10 %)	0 to 2,500 Hz	0 to 2,500 Hz						
esonant Frequency	11.8 kHz	11.8 kHz	[2]					
nase Response(100 Hz)	< 10 °	< 10 °						
on-Linearity(Typical)	0.3 %	0.3 %	[3]					
on-Linearity(Max)	1 %	1 %	[3]					
oadband Resolution(0.5 to 100 Hz)	6 mg rms	0.06 m/s ² rms	[2]					
ansverse Sensitivity(Typical)	1 %	1 %						
ansverse Sensitivity(Max)	3 %	3 %						
nvironmental	5 000	10.050 / 2 /						
verload Limit(Shock)	± 5,000 g pk	± 49,050 m/s² pk						
emperature Range(Operating)	-65 to +250 °F	-54.0 to +121 °C						
emperature Range(Storage)	-65 to +250 °F	-54.0 to 121 ℃	[4][2]					
emperature Coefficient of Sensitivity	± 1 %	±1%	[4][2]					
ero g Offset Temperature Coefficient	± 1 % FSO	± 1 % FSO	[4][5][2]					
ase Strain Sensitivity	.001 g/με	.01 (m/s²)/με	[2]					
lagnetic Sensitivity	40 μg/gauss	3.9 (m/s²)/Tesla	[2]					
lectrical								
citation Voltage	5 to 32 VDC	5 to 32 VDC						
urrent Consumption	≤ 15 mA	≤ 15 mA						
utput Impedance	≤ 120 Ohm	≤ 120 Ohm	[6]					
ffset Voltage(0 g)	± 20 mVDC	± 20 mVDC	[6]					
ommon Mode Voltage(+/- 0.1 VDC) pectral Noise(1 Hz)	1.65 VDC 600 µg/√Hz	1.65 VDC 5,886 (µm/s²)/√Hz	[2]					
			[2]					
pectral Noise(10 Hz) pectral Noise(100 Hz)	600 μg/√Hz 600 μg/√Hz	5,886 (µm/s²)/√Hz 5,886 (µm/s²)/√Hz	[2] [2]					
ectrical Isolation(Case)			[4]					
	> 10 ⁸ Ohm	> 10 ⁸ Ohm						
hysical								
ousing Material	Stainless Steel	Stainless Steel						
ealing	Hermetic	Hermetic						
ze (Length x Width x Height)	0.76 in x 1.03 in x 0.66 in	19.3 mm x 26.2 mm x 16.8		NOTES:				
· · · · .		mm			100 Hz, 10 grms.			
/eight	0.92 oz	26 gm	[2]	[2]Typical.				
ectrical Connector	8-Pin	8-Pin			least-squares, straigh			
ectrical Connection Position	Side	Side			°F, ref. 75 °F (-54 to +			
lounting Thread	Through Hole	Through Hole			ale Output over the N		e	
					nce is based on 10ft o		9-	
				[/]See PCB Dec	laration of Conforma	nce PS027 for deta	IIS.	
				SUPPLIED AC			# -1 - L (D)	
					Mounting screw and			
				Model ACS-1721	i Triaxial Phase and A	implitude Calibrati	on from 5 Hz to +5% fre	quency range (1
							-	
l f				Entered: ND	Engineer: JJD	Sales: JM	Approved: NJF	Spec Number
				Date: 01/09/2025	Date: 01/09/2025	Date: 01/09/20	25 Date: 01/09/2025	79084
JK					-	Pho	ne: 716-684-0001	
				🚽 🧐 PCB	PIEZOTRO	Fax:	716-684-0987	
					AN AMPHENO		ail: info@pcb.com	
Il specifications are at room temperature the interest of constant product improve	unless otherwise specified.	and enerifications without	notico	3425 Walden Ave	enue, Depew, NY 140			
the interest of constant product improve				SHES WORKER AVE				
is model designated with an RH profix is								
nis model, designated with an RH prefix, i onformance, please visit http://www.pcb			15 Statement of					

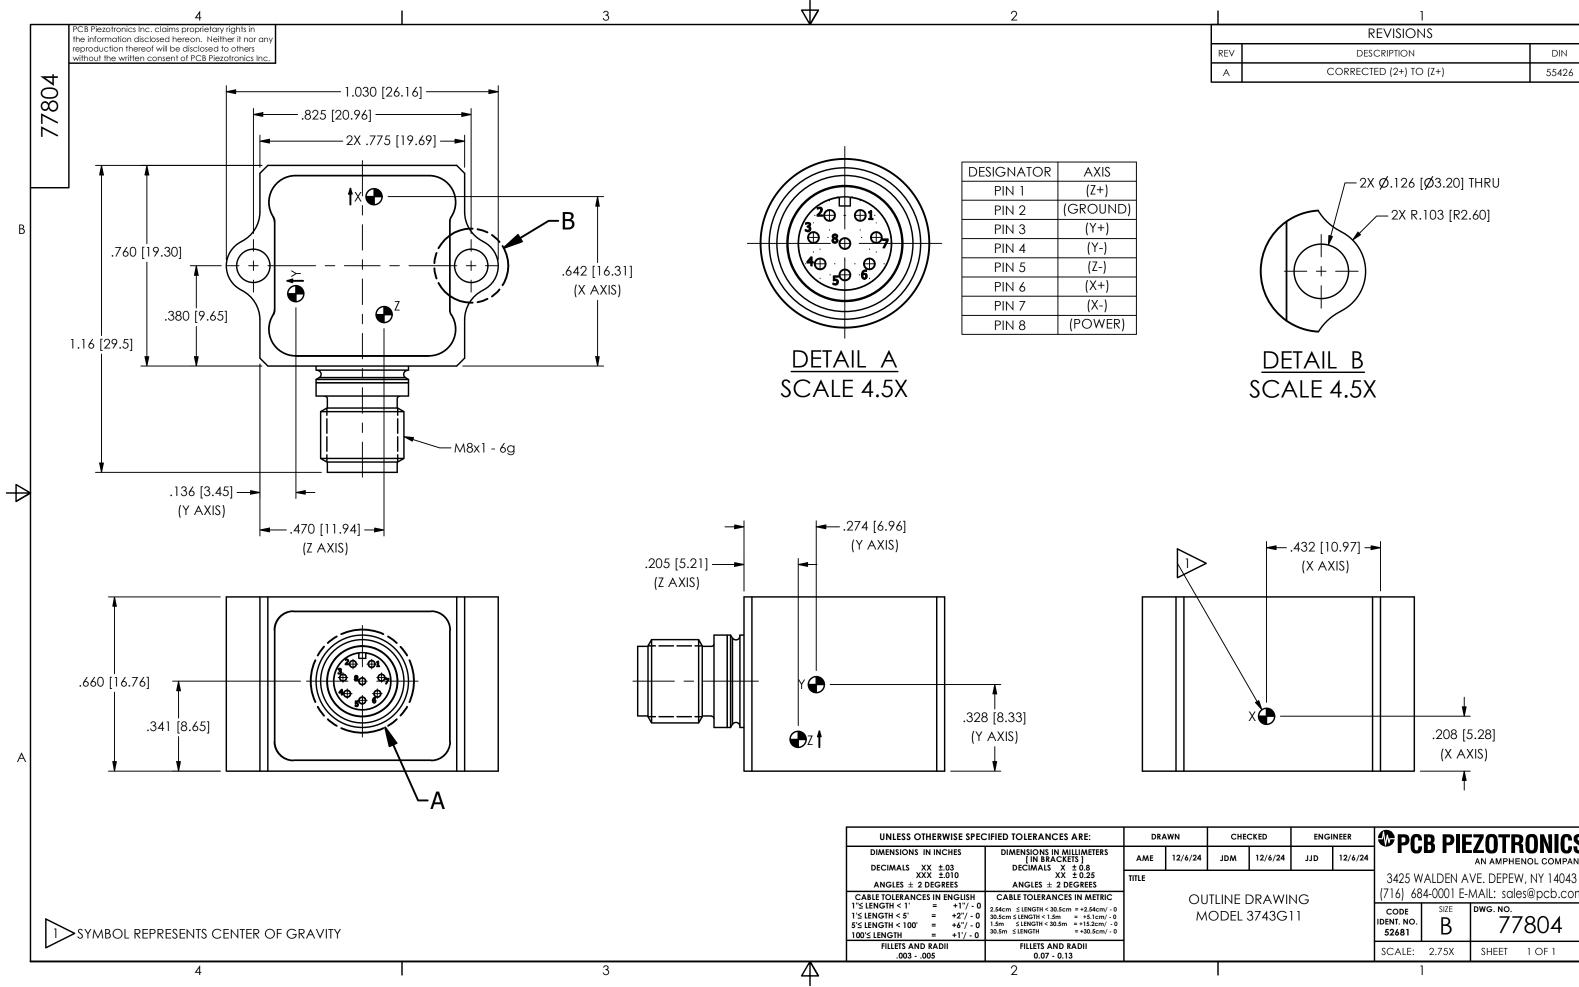

	1	
	REVISIONS	
REV	DESCRIPTION	DIN
А	CORRECTED (2+) TO (Z+)	55426

В

 \triangleleft

А

	CHECKED		ENG	INEER	l � ⊂ D ∩	R PIF	:7 0 TE	SUNIUG		
/24	JDW	12/6/24	DIL	12/6/24	PCB PIEZOTRONICS					
		DRAWII 3743G					MAIL: sale	W, NY 14043 es@pcb.com 7804		
					SCALE:	2.75X	SHEET	1 OF 1		
1										